



Lifting (Wrinkling, Swelling, Shriveling, Rippling, Raising, Crinkling)

Description

Surface defect that occurs while paint is being applied or while drying. Non uniform drying within the coat.

Cause

- Insufficient drying time between coats;
- Excessive film thickness;
- Use of incompatible products;
- Forced drying/fanning;
- Use of wrong or poor quality thinner;

Prevention

- Avoid using incompatible materials – synthetic products and 2K products;
- Avoid applying of heavy coats. Apply paint in thin coats;
- Allow sufficient drying time between coats;
- Ensure uniform drying temperature;
- Use only recommended thinners;

Rectification

- Allow the paint film to dry, flat, compound and polish the affected area;
- In severe cases remove paint by sanding and repaint;

