



Bridging

Description

Coat cracked around sharp edges such as masking tape edges, joints, grooves, corners, etc.

Cause

- Insufficient sanding around sharp edges resulting in poor adhesion;
- Excessive paint film thickness on these areas;

Prevention

- Properly prepared surface, detailed sanding around sharp edges;
- Avoid application of too heavy coats around corners and sharp edges;

Rectification

- Remove paint from affected area, detail sand and refinish
- Apply lighter coats and allow prolong drying time between coats;